


SRI 400PIV, 10MA

Note 1 - This jumper strap may be removed if ungrounded low impedance outputs are desired.

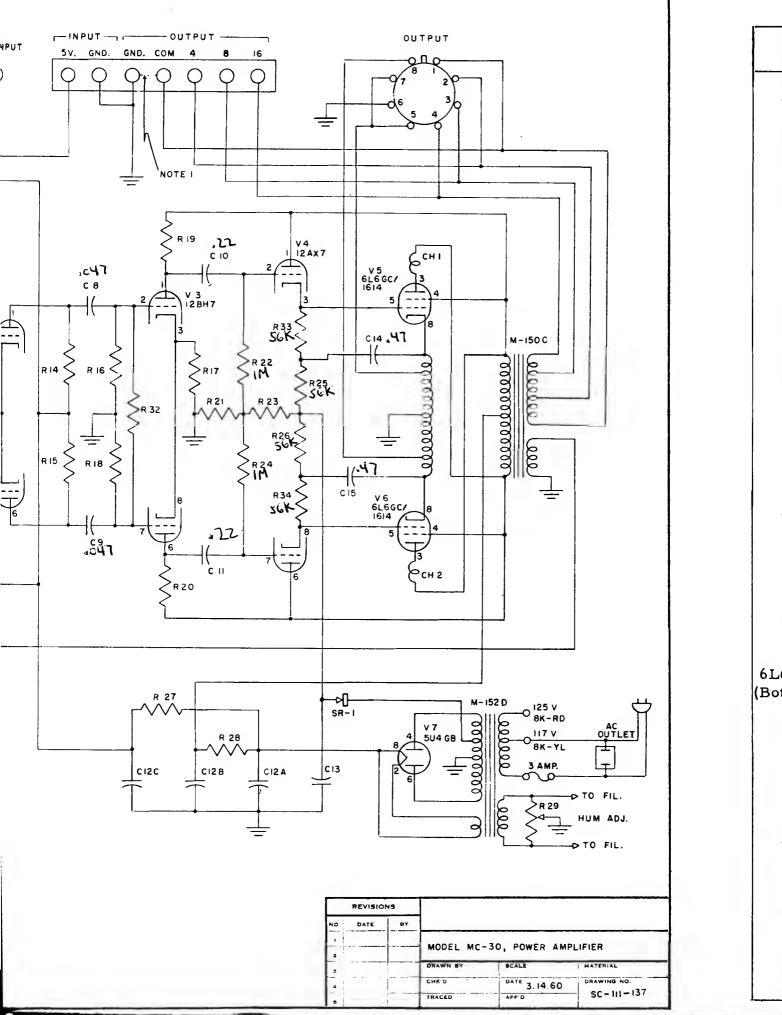

Tub 12A (Inp

12A

12B

12A

6L6GC (Both

5 U4

## VOLTAGE AND RESISTANCE CHART

be	Pin No.	DC Volts	DC Volts	AC Volts	Resistance
AX7	Fin No.	No Signal	at 30W out	at 30W out	Unit off
put)	1	134	120	1.3	330K*
puty	2	0	0	Ĭ	
	3	1.2	1	0.24	1 M
		li .	1.1	0.22	3.3K
	4&5	Fil	6.3 V. ac to Pin 9	-	0 to 70
	6,7,8	-	\	-	
	9	Fil	-	-	0 to 70
AU7	1	270	235	9	40*
	2	134	120	13	330K*
	3 & 8	138	126	0.57	18K
	4&5	Fil	6.3 V. ac to Pin 9	-	0 to 70
	6	270	235	9	43K*
	7	110	100	0	26M*
	9	Fil	-	-	0 to 70
ВН7	1	355	295	132	12K*
	2	0	0	9	220K
	3 & 8	16	14	0.32	1.2K
	4 & 5	Fil	6.3 V. ac to Pin 9		0 to 70
	6	355	295	132	12 <b>K</b> *
	7	0	0	9	220K
	9	Fil	-	-	0 to 70
<b>AX</b> 7	1	440	365	94	185*
	2	-46	-46	134	1 M
	3	-45	-45	118	270K
	4&5	Fil	6.3 V. ac to Pin 9	-	0 to 70
	6	440	365	94	185*
	7	-46	-46	134	l M
	8	-45	-45	118	270K
	9	Fil	-	-	0 to 70
C/1614	1	0	0	0	
Cubes)	2	Fil		0	-
Iuves	3	440	6.3 V. ac to Pin 7		0 to 70
	4	440		94	200*
			365	94	200*
	5 6	-45	-45	118	270K
	6	-	-	-	-
	7	Fil	-	- /2s.	0 to 70
	8	1.1	2.7	94	25
IGВ	1	-	-	_	_
	2	455	400	7.9 (Ripple)	0*
	3	-	_	, ,,	
	4	395 AC	385 AC	385	45
	5	-	_	303	- <del>- 1</del>
	6	395 AC	385 AC	385	45
	7	-	-	707	<del>*</del> 5
	8	455	400		0*